

RE: GAS SERVICE LINE HIT NEAR 232 ANGLER

The following report recaps the events that took place on May 3, 2019 when the gas service line was hit near 232 Angler Ave.


There was a site meeting with the locator and the driller on Thursday May 2, 2019. They went over the areas that were scheduled to to be drilled prior to any drilling occuring in that area. The service line was marked and was potholed to determine its depth prior to drilling.

TIME LINE:


- 1) Hit occurred around 10:50 AM on 5/3/19. 911 Emergency was called and and an e-mail was sent to the Town and others about the service line hit.
- 2) Police arrived at 10:55 AM, Fire arrived at 11:00 AM. Site was secured.
- 3) FPU Gas arrives at 11:30 AM. Excess flow valve completely shut off at 12:15 PM
- 4) Police & Fire Leave Site at 12:40 PM
- 5) Gas repair completed at 1:15 PM
- 6) Drilling starts back up at 1:35 PM

The drilling crew had sucessfully made 2 previous drills under this gas service on Thursday and Friday morning. This was the third bore that was made and the reason that the line got hit is because it dropped in elevation to go under an abandoned water main. Bore #1 consisted of 1Ea. 5" AT&T Pipe. Bore #2 consisted of 1 Ea. 5" AT&T, 1 Ea. 2" AT&T, 1 Ea. 1" AT&T, 1 Ea. 3" COMCAST, and 1 Ea. 1" COMCAST pipe. Bore #3 consisted of 5 Ea. 2" FPL pipe.

TOP VIEW

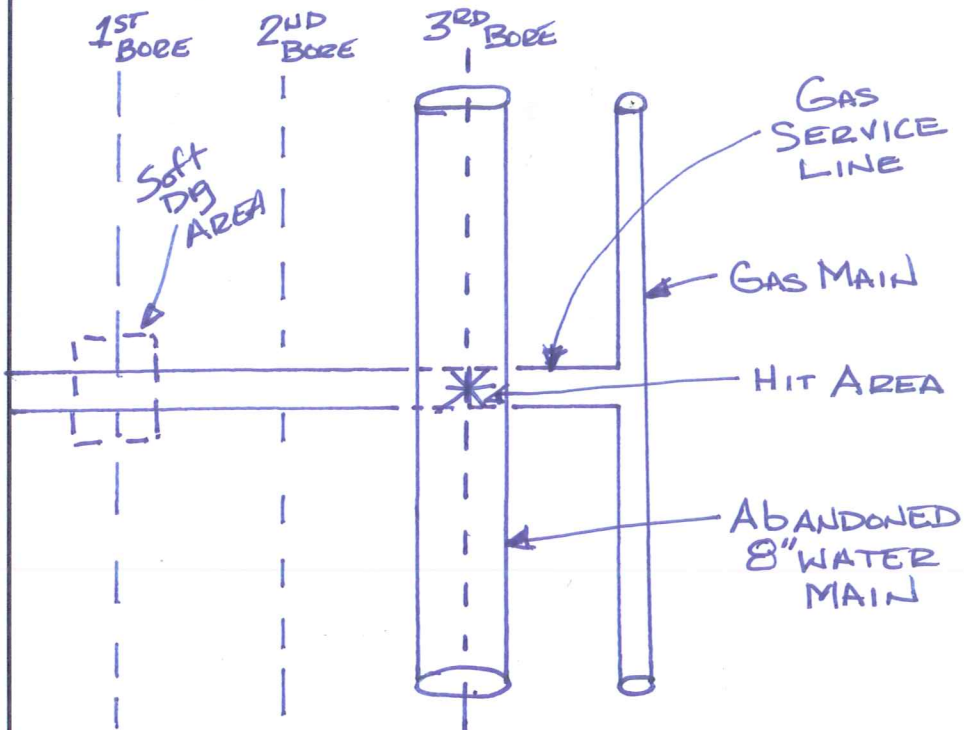

PROFILE VIEW

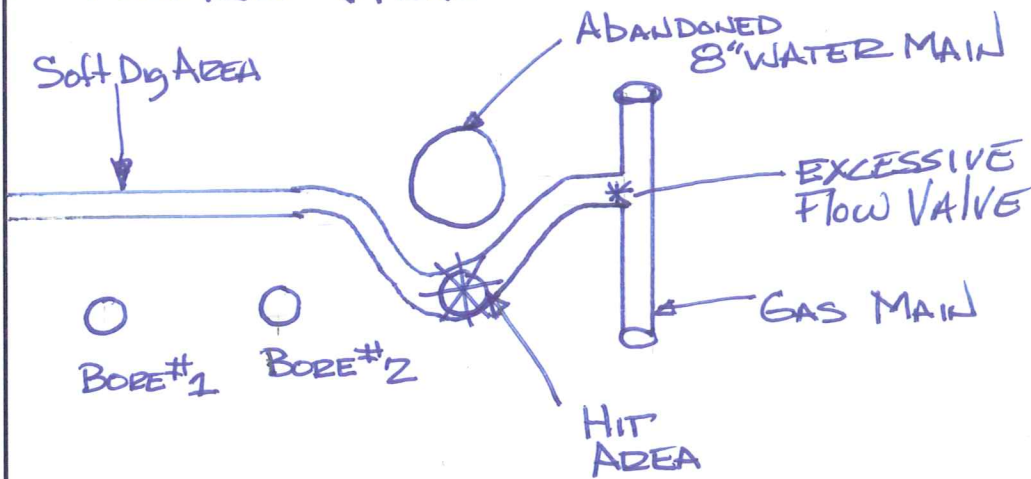

EXCESS FLOW VALVE

GAS SERVICE
LINE

ABANDONED WATER MAIN

DRILLING ROD

GAS SERVICE LINE

SOFT DIG AREA





SOFT DIG AREA

GAS SERVICE LINE

WATER MAIN

GAS SERVICE LINE










US Dept of State Geographer
© 2018 Google

© 2019 Google





Find address or place

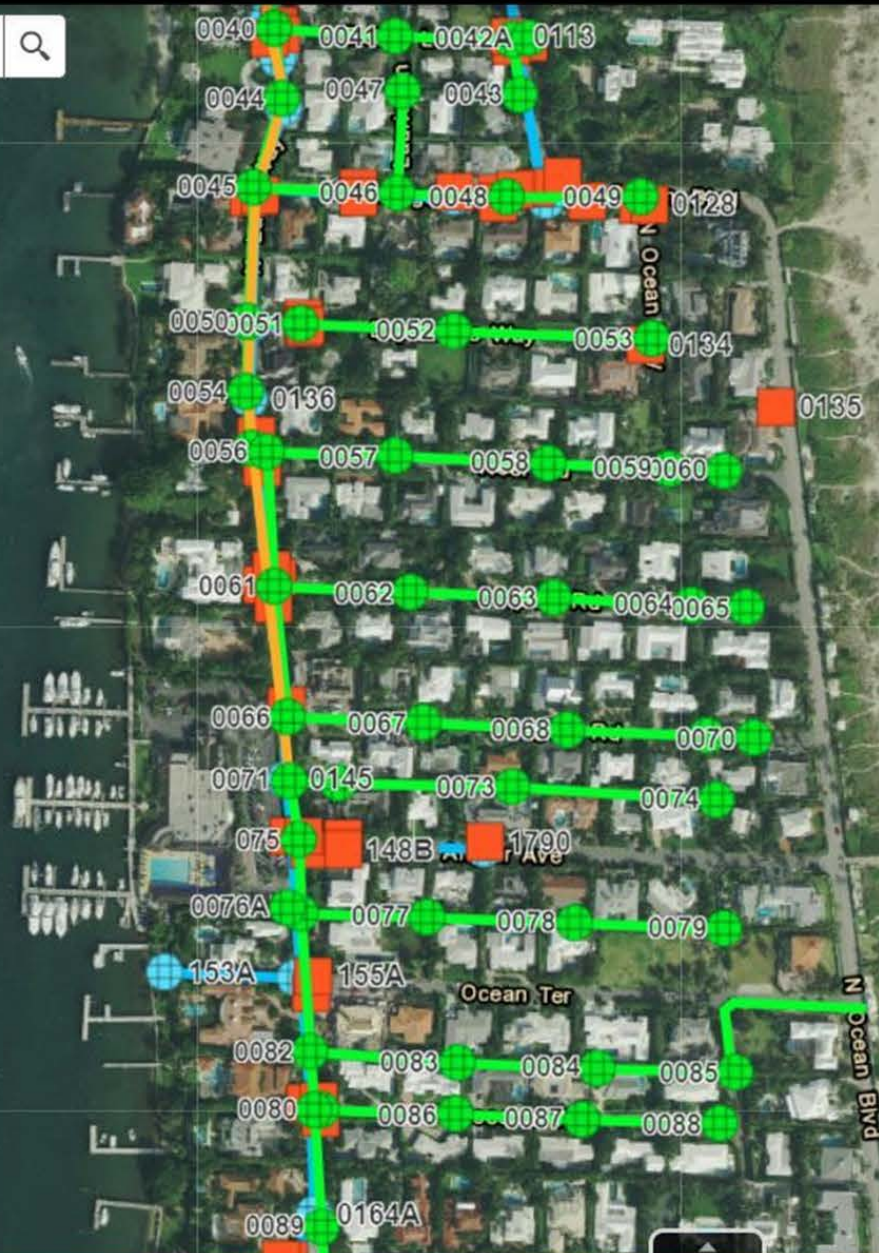

Legend_3

TOPB Sewer Manholes



TOPB Sewer Pressurized Force Main



TOPB Sewer Gravity Mains



TOPB Storm Inlet Basin



TOPB Storm ManHole



TOPB Storm Gravity Main



World Transportation

World Transportation